

Cross-section of Sensor Chip>
Silicon
Piezo resistance
strain gauge

Anode
junction

Pressure
Glass
base

High reliability
die bonding
technology
Very strong,
heat resistant body
Pressure

A wide range of rated pressure, including a minute pressure

There are 10 types of sensors covering a wide range of rated pressure from a minute pressure between 4.9 kPa {0.05 kgf/cm²}, to a maximum pressure of 980.7 kPa {10 kgf/cm²}.

Realization of highly accurate, linear characteristics

This sensor employs a semiconductor strain gauge method, ensuring accurate and linear detection characteristics. It also has excellent repeatability of pressure characteristics.


Impressive line-up of models

- Taking their place alongside the standard $5k\Omega$ bridge resistance models are those with a $3.3k\Omega$ resistance which is optimally suited to 5V drive circuits.
- Economy model (no glass base) gives outstanding value for consumer appliances

40 kPa (0.4 kgf/cm²) and 49 kPa (0.5 kgf/cm²) units are also available.

(when the rated pressure is between 98 {1.0 kgf/cm²}


Drive current: 1.5 mA rated current; ambient temperature:

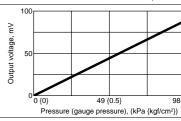

TYPICAL APPLICATIONS

- Medical equipment: Electronic help
- Home appliance: Vacuum cleaner
- Gas equipment: Microprocessor g meter, gas leakage detector
- Industrial equipment: Absorption device, etc.

ORDERING INFORMATION

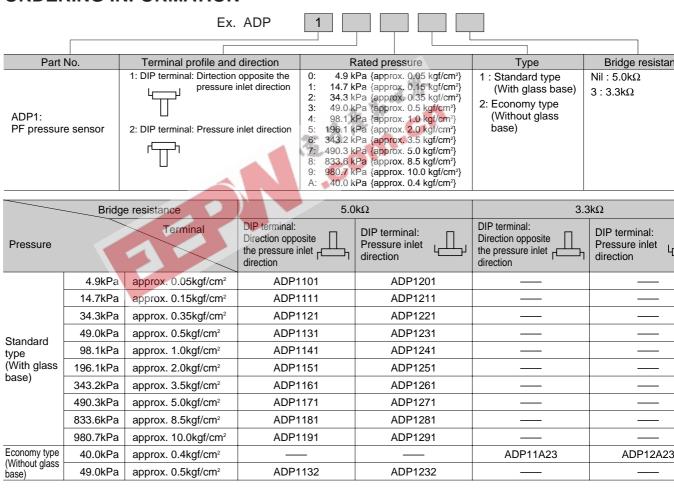

bridge resistance	3000±1000 <u>\$2</u>					3300±000 22	300011000 22
Ambient temperature	-20 to 100°C −4 to 212°F (no freezing or condensation)						-20 to 100°C -4 to 212°F
Storage temperature	-40 to 120°C -40 to 248°F (no freezing or condensation)						-40 to 120°C -70 to 248°F
Temperature compensation range	0 to 50°C 32 to 122°F					0 to 50°C 32 to 122°F	
Drive current (constant current)	1.5 mA DC						
Output span voltage	40±20 mV 100±40 mV				43.5±22.5 mV	85±45 mV	
Offset voltage	±20 mV			±15 mV	±25 mV		
Linearity	±0.7%FS	±0.5%FS ±0.3%FS ±0.6%FS		±0.3	%FS		
Pressure hysteresis	±0.6%FS	±0.4%FS ±0.2%FS ±0.4%FS			±0.7%FS		
Offset voltage-temperature characteristics (0 to 50°C 32 to 122°F)	±15%FS	±5.0%FS			±10%FS	±8%FS	
Sensitivity-temperature characteristics (0 to 50°C 32 to 122°F)	±10%FS	10%FS ±2.5%FS			±1.3%FS	±2.5%FS	

Notes) 1. Unless otherwise specified, measurements were taken with a drive current of 1.5 mA ±0.01 mA at a temperature of 25°C 77°F and humidity ranging from 25% to 85%.

- 2. Please consult us if a pressure medium other than air is to be used.
- 3. This is the regulation which applies within the compensation temperature range.
- 4. Please consult us if the intended use involves a negative pressure.


DATA

1. Characteristics data

1-<1> Output characteristics

ADP1141


Drive current: 1.5 mA; temperature: 25°C 77°F

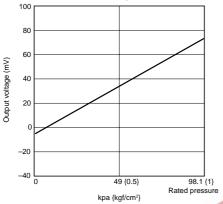

1-<2> Offset voltage – temperature characteristics

ADP1141


Drive current: 1.5 mA; rating ±5%FS

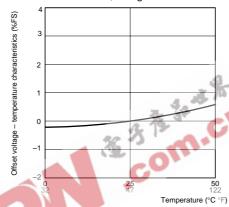

1-<3> Sensitivity – temperature characteristics (%FS)

ADP1141


Drive current: 1.5 mA; rating ±2.5%FS

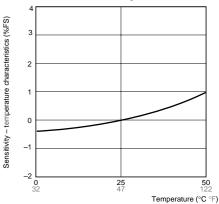


2. Pressure cycle range (0 to rated pressure)

Tested sample: ADP1131, temperature: 25°C 77°F

2-<1> Offset voltage range

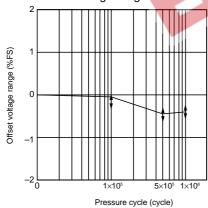

2-<2> Output span voltage range

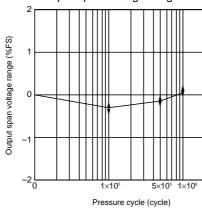

Even after testing for 1 million times, the variations in the offset voltage and output span voltage are minimal.



		16/11poratare. 40 0 to 120 0 40 1 to 240 1	
Temperature cycle		1 cycle: 30 min.	
		Times of cycle: 100	
Endurance characteristics	High temperature/high humidity operation	Temperature/humidity: 40°C 104°F, 90% RH Operation times: 10 ⁶ , rated voltage applied	Pass
Mechanical characteristics	Vibration resistance	Double amplitude: 1.5 mm .059 inch Vibration: 10 to 55 Hz Applied vibration direction: X, Y, Z 3 directions Times: 2 hrs each	Pass
	Dropping resistance	Dropping height: 75 cm 29.528 inch Times: 2 times	Pass
	Terminal strength	Pulling strength: 9.8 N {1 kgf}, 10 sec. Bending strength: 4.9 N {0.5 kgf}, left and right 90° 1 time	Pass
Soldering Resistance	Soldered in DIP soldering bath	Temperature: 230°C 446°F Time: 5 sec.	Pass
	Temperature	Temperature: 260°C 500°F Time: 10 sec.	Pass

Note: For details other than listed above, please consult us.


DIMENTIONS


2. Terminal direction: Pressure inlet direction

ADP12□□ (□)


Atmospheric pressure inlet hole

 Terminal direction: Direction opposite the pressure inlet derection ADP11□□ (□)

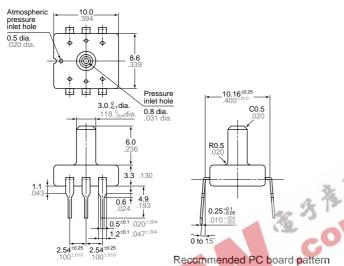

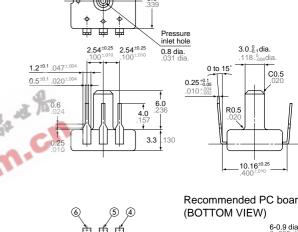





Tolerance: ±0.1 .004




6-0.9 6-0.35 6-0.35 10 2.36 dia. 2.54 .100 2.54 .100 5.08 .200

General tolerance: ±0.3 ±.012 m

Tolerance: ±0.1

3. Terminal connection diagram



Terminal No.	Name	
1	Output (–)	
2	Power supply (+)	
3	Output (+)	
4	No connection	
5	Power supply (-)	
6	Output (-)	

Note: Leave terminal 4 unconnected.

the effects of external heat. Dip soldering bath: Max. 260°C 500°F, 5

Soldering iron: 260 to 300°C 500 to

572°F (30W) within 5 sec.

2) Use a non-corrosive resin type of flux. Since the pressure sensor DIP type is exposed to the atmosphere, do not allow flux to enter inside.

3. Cleaning

sec.

- 1) Since the pressure sensor chip is exposed to the atmosphere, do not allow cleaning fluid to enter inside.
- 2) Avoid ultrasonic cleaning since this may cause breaks or disconnections in the wiring.

4. Environment

Consult with us before using or storing the pressure sensor chip in a place exposed to corrosive gases (such as the gases given off by organic solvents, sulfites, hydrogen sulfides, etc.) which will adversely affect the performance of the pressure sensor chip.

5. Quality check under actual loading conditions

- 1) To assure reliability, check the sensor under actual loading conditions. Avoid any situation that may adversely affect its performance.
- 2) As for test data, please contact us.

- an organic solvent, sulfite or hydrogen sulfide) as the pressure medium.
- 3) The pressure sensor chip is positioned inside the pressure inlet. Never poke wires or other foreign matter through the pressure inlet since they may damage the chip or block the inlet. Avoid use when the atmospheric pressure inlet is blocked.
- 4) Leave pin No. 4 unconnected since the pressure sensor chip may be damaged if a voltage is applied to this pin. 5) Use an operating pressure which is

within the rated pressure range. Using a pressure beyond this range may cause damage.

6) Since this pressure sensor chip does


freezes.

not have a water-proof construction, consult with us if it is to be used in a location where it may be sprayed with water, etc. 7) Avoid using the pressure sensor chip in an environment where condensation may form. Furthermore, its output may fluctuate if any moisture adhering to it

- 9) Avoid using the pressure sensor chip where it will be susceptible to ultrasonic or other high-frequency vibration.
- 10) Since static charge can damage the pressure sensor chip, bear in mind the following handling precautions.
- When storing the pressure sensor chips, use a conductive material to short the pins or wrap the entire chip in aluminum foil. Plastic containers should not be used to store or transport the chips since they readily become charged.
- When using the pressure sensor chips, all the charged articles on the bench surface and the work personnel should be grounded so that any ambient static will be safely discharged.
- 11) Due to the pressures involved, give due consideration to the securing of the pressure sensor DIP type and to the securing and selection of the inlet tube. Consult us if you have any queries.

APPLICATION CIRCUIT **DIAGRAM (EXAMPLE)**

The pressure sensor is designed to convert a voltage by means of constant current drive and then, if necessary, it amplifies the voltage for use. The circuit shown below is a typical example of a circuit in which the pressure sensor is used.

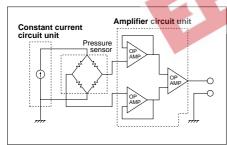

MOUNTING METHOD

The general method for transmitting air pressures differs depending on whether the pressure is low or high.

- Checkpoints for use
- <1> Select a pressure inlet pipe which is sturdy enough to prevent pressure leaks.
- <2> Fix the pressure inlet pipe securely so as to prevent pressure leaks.
- <3> Do not block the pressure inlet pipe.

Methods of transmitting air pressures

